

1718 W. Fullerton Chicago, IL 60614
Ph: 773.770.1195 • Fax: 773.935.5613
www.PureEdgeLighting.com • info@PureEdgeLighting.com
© 2016 PureEdge Lighting. All Rights Reserved.

Installation Instructions for **Pipeline 1 Suspension Downlight with Remote Power - End Feed with 4" Canopy**




IMPORTANT INFORMATION

- This instruction shows a typical installation.
- It is recommended more than one person to assist in this installation.

SAVE THESE INSTRUCTIONS!



Section One: Install the Standoff

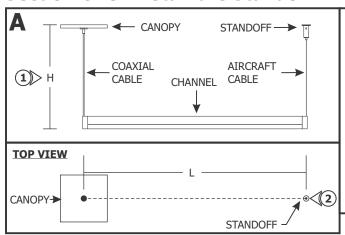

NOTE: Run the proper size wires from the 24VDC power supply to the junction box. Refer to the instructions provided with the power supply for additional information.


NOTE: Omit Section Four if the channel is made out of a single piece.


- **1:** Determine the fixture height (H) from the bottom of the channel to the top of the canopy.
- **2:** Determine the fixture length (L). Measure the distance between the coaxial cable and aircraft cable on the channel. Mark the standoff location on the ceiling from the center of the junction box.

NOTE: Omit steps 3 through 7 if using support canopy. Refer to Section Two: Install the Support Canopy.


NOTE: Omit steps 3 and 4 if mounting directly onto a wood surface.

- **3:** For each provided standoff, tap the anchor onto the marked location up to the threaded portion with a hammer.
- **4:** Screw in the threaded portion of the anchors with a Phillips screwdriver.

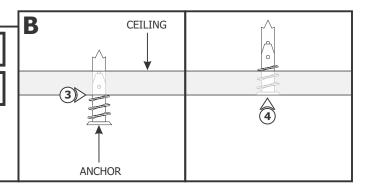


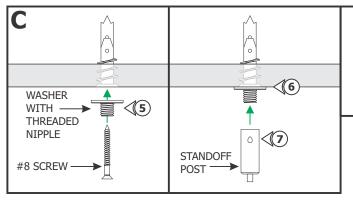

- **5:** Feed the #8 screw through the washer with threaded nipple into the anchor.
- **6:** Tighten the #8 screw completely into the anchor.
- **7:** Tighten the standoff post completely onto the threaded nipple.

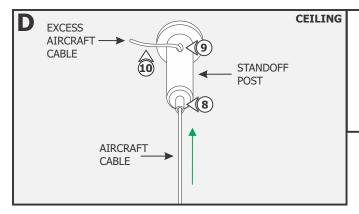


- **8:** Feed the aircraft cable coming from the channel through the standoff post.
- **9:** Adjust the fixture height by pushing the tab and pulling the aircraft cable out of the side of the standoff post. Release the tab to secure the cable in place.
- **10:** If necessary, trim excess aircraft cable using sharp cutters.

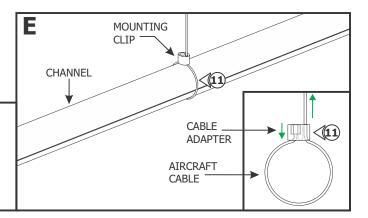


- 11: For additional support, feed the aircraft cable through the Suspension Cable Adapter. Slide the Suspension Mounting Clip over the channel and adjust the position by moving it across the channel.
- **12:** Repeat steps 3 through 10 to install the standoff for the Suspension Mounting Clip.


Section Two: Install the Support Canopy (4R2 or 4S2 Version)

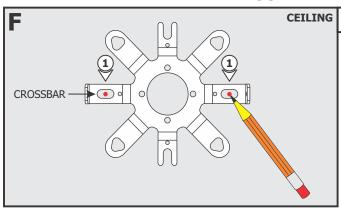


 1: Mark two points through the crossbar holes onto the ceiling.




- **2:** Tap the anchors onto the marked points up to the threaded portion with a hammer. Screw in the threaded portion of the anchors with a Phillips screwdriver.
- **3:** Secure the crossbar to the anchors using the two #8 screws.

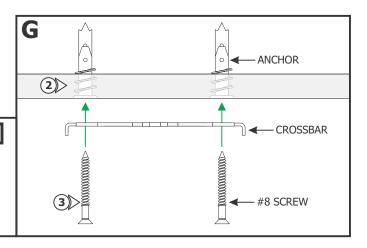

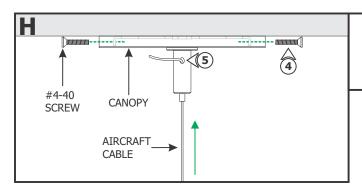

- **4:** Align the canopy with the crossbar and secure it using the two #4-40 screws using a 1/16" Allen wrench.
- **5:** Refer to steps 8 through 10 in Section One to adjust the fixture height.

Section Three: Power the Fixture

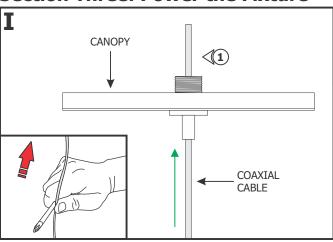

1: Feed the coaxial cable through the canopy.


NOTE: If cable is curled or kinked, straighten by holding between the shaft of a screwdriver and thumb and pulling the cable through (see inset).




NOTE: Scan the QR Code to watch the video clip of the following steps or visit https://www.PureEdgeLighting.com/video_feed/

https://www.PureEdgeLighting.com/video_feed/installation_cxc_connector


- **2:** Use the 18AWG hole of the wire stripper to remove 1-3/8" of the outer insulation to expose the braided wire.
- **3:** Use the 18AWG hole of the wire stripper to remove 1" of the braided wire making sure not to nick the inner wire insulation.
- **4:** Use the 20AWG hole of the wire stripper to remove 1/8" of the inner insulated wire.

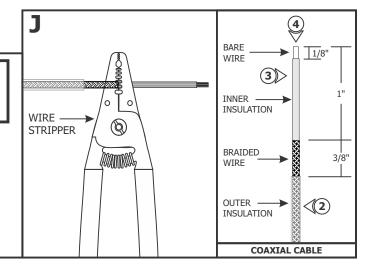


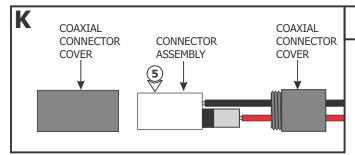


5: Unscrew the coaxial connector covers and remove from the connector assembly.

- **6:** Using the provided 1.5mm Allen wrench, remove the M3 set screw from the coaxial connector assembly.
- **7:** Using the provided 2mm Allen wrench to loosen (do not remove) the M4 set screw.

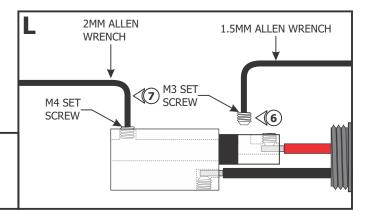

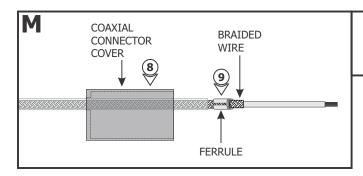



- 8: Slide the connector cover over the coaxial cable.
- **9:** Place the ferrule over the 3/8" braided wire of the coaxial cable.

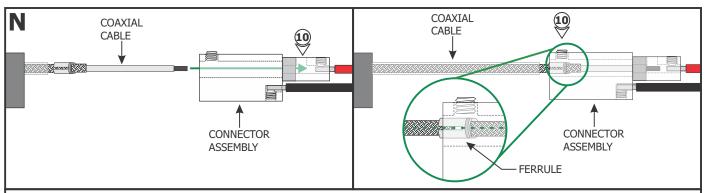

10: Insert the coaxial cable into the coaxial connector until the wires of the center conductor are visible through the M3 set screw hole.

NOTE: Ensure that the split in the ferrule is aligned 90° from the M4 set screw (see inset).

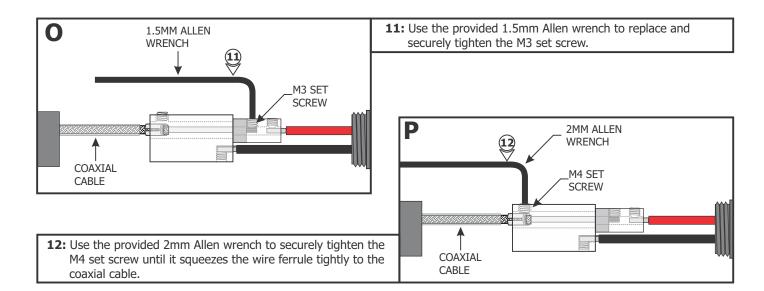


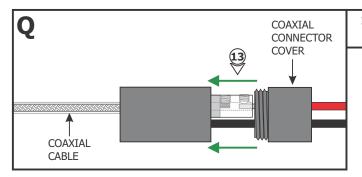


13: Replace the coaxial connector cover and tighten into place.


NOTE: Ensure remote power supply wires are present in the junction box. Refer to instructions provided with the power supply.

- **14:** Feed the low voltage 24VDC wires from the power supply through the crossbar center hole.
- **15:** Mount the crossbar to the junction box holes with two #8-32 screws.

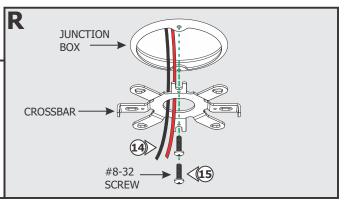


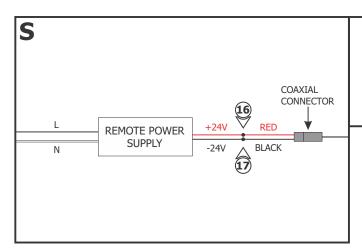

 
- **16:** Connect the red wire of the coaxial connector to the +24VDC power supply wire with a wire nut.
- **17:** Connect the black wire of the coaxial connector to the -24VDC power supply wire with a wire nut.
- **18:** Place all connections inside the junction box.



20: For fine adjusting the fixture height, push the cord grip to slide the fixture up and down until the desired height is achieved. Release the cord grip to lock the coaxial cable in place.

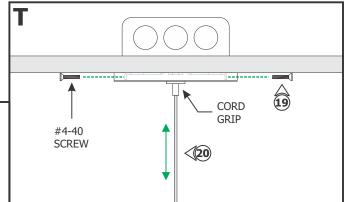

Section Five: Multiple Channel Sections

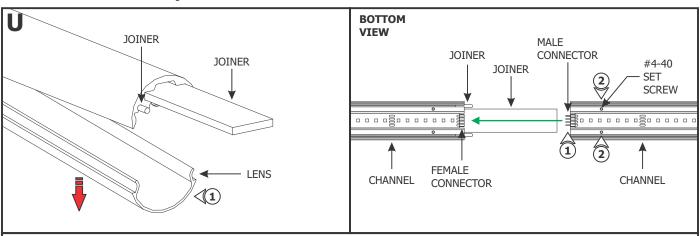

NOTE: If applicable, multiple channels must be installed one by one.

NOTE: Omit this section if the joiner did not come with the fixture depending on the overall fixture length.

- **1:** Lift a section of the lens at the end of the channels where the connectors are visible. Slide the channel over the joiner and ensure the male & female connectors mate properly.
- 2: Tighten the two #4-40 set screws using a 0.05" Allen wrench.
- 3: Push the lens back into the channel.

General Wiring Diagrams

