
Mounting Instruction

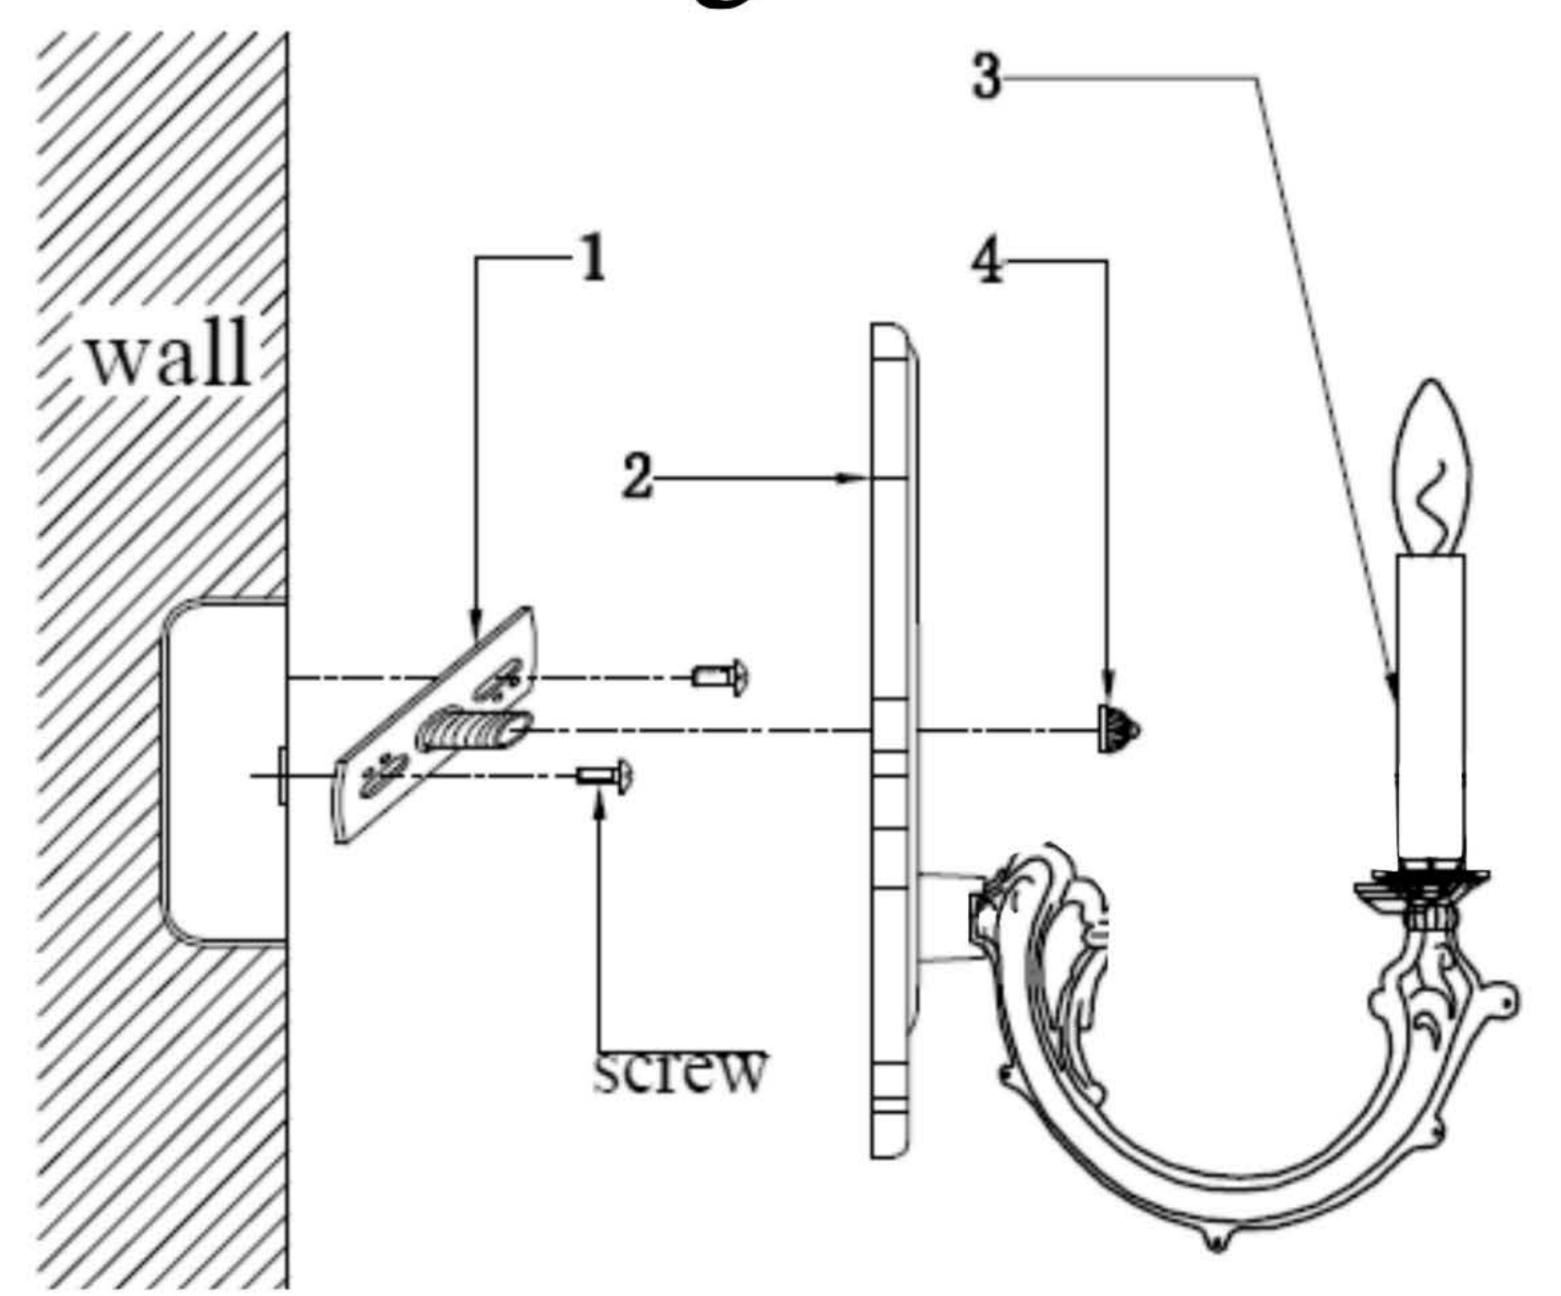


NOTE: Diagrams above are just representative.


mounting block
 nipple

main body

3.candle pipe

Electrical Diagram

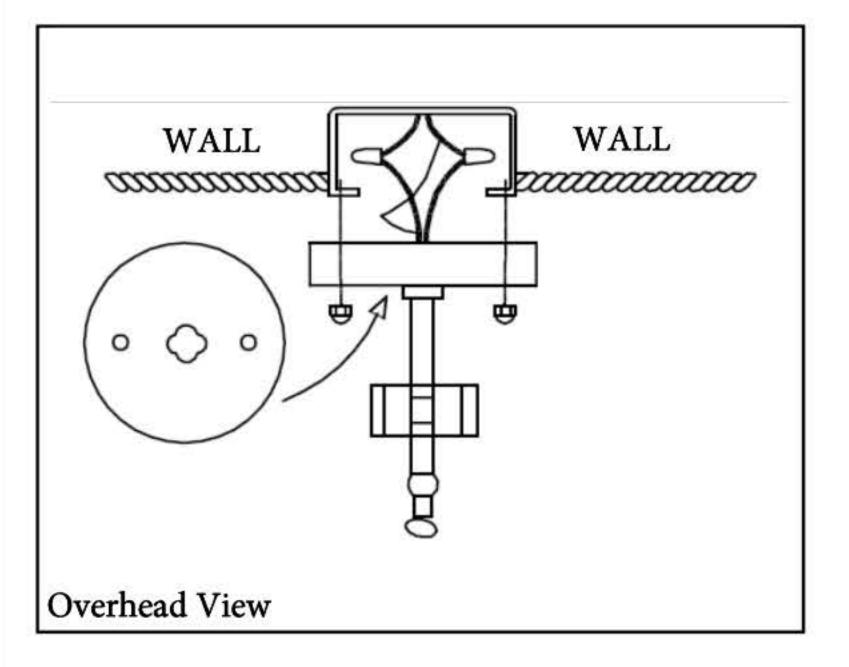

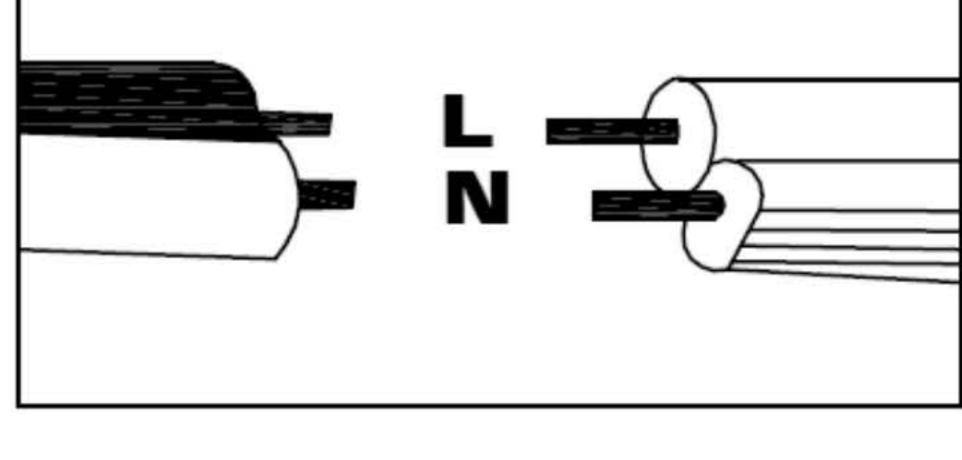

All electrical components must be installed by a liscensed electrician and in accordance with the National Electric Code and the appropriate local electrical codes.

American Brass & Crystal

Casting a Finer Light



WS9062

American Brass and Crystal provides the finest quality components manufactured, designed and finished by master artisans. We take great pride in our production abilities and we empower our valued customers with the ability to custom create the light that is perfect for them.

Enclosed are detailed instructions on how to properly assemble and install your sconce. If you have any questions please call our toll free customer service hotline at: 1-(877)-465-5617

American Brass and Crystal
835 Lehigh Avenue, Union, NJ 07083

www.abclighting.net



Crystal Component Detail

Begin trimming your chandelier after all of the electrical connections have been made, the lights have been tested and the chandelier is in good working order. Begin trimming in Alphabetical order. Do not unwrap the next letter until previous one is complete.



Letter: A
Quantity: 4

3" Drop w/1-14mm Oct.

Connect to middle and front holes on both arms.



Letter: B
Quantity: 12

3" U Drop w/1-14mm Oct.

Connect to six holes around each of the bobeches.

Crystal Trimming Directions

