



1718 W. Fullerton Chicago, IL 60614
 Ph: 773.770.1195 • Fax: 773.935.5613
 www.PureEdgeLighting.com • info@PureEdgeLighting.com
 © 2016 PureEdge Lighting. All Rights Reserved.

Installation Instructions for **Track Surface Mount End Power Feed, Single Circuit with 1/2" Conduit Feed Connector**

TS24-EC1_

IMPORTANT INFORMATION


- This instruction shows a typical installation.
- The fixtures used with the PureEdge Lighting systems must be identified for use with the corresponding PureEdge Lighting systems.

SAVE THESE INSTRUCTIONS!




Install the Conduit Feed Connector

A

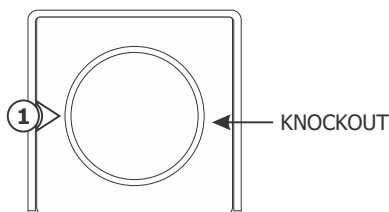


- 1:** Remove the knockout on the back of the Conduit Feed Connector using a flathead screwdriver or other appropriate tool.

B

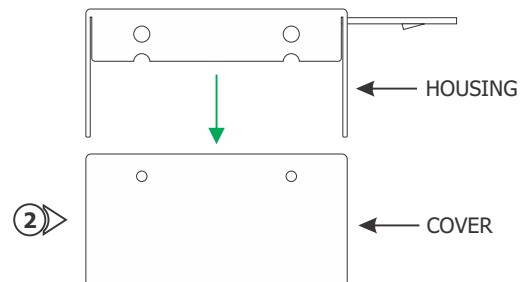


- 2:** Remove the cover from the Conduit Feed Connector housing.

C

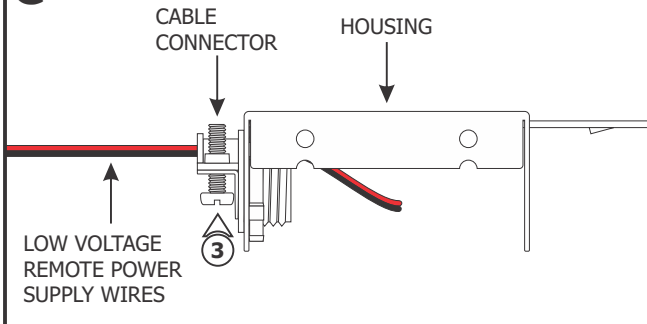


- 3:** Install an appropriate 1/2" fitting cable connector to the housing and run low-voltage 24VDC power wires coming from the remote power supply into the housing.

D


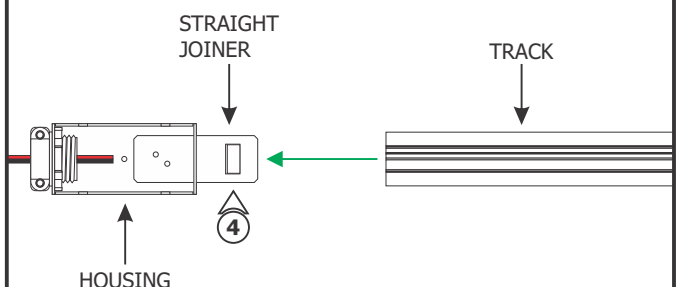


- 4:** Slide the track over the straight joiner on the housing.

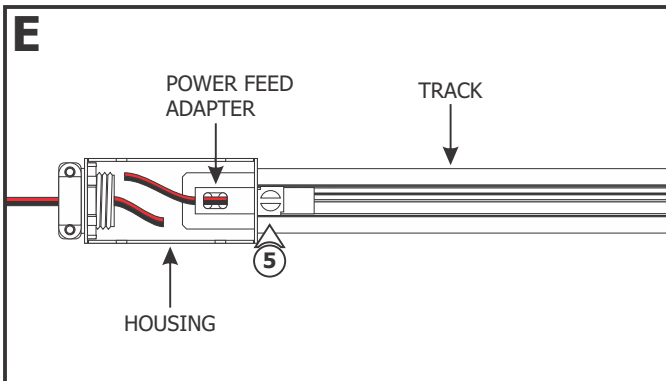

5: Place the Power Feed Adapter halfway through the housing and halfway into the track. Tighten the slotted screw of the Power Feed Adapter with a flat-head screw driver to secure in place.

- 6:** Connect the low voltage +24VDC remote power supply wire to the red wire of the Power Feed Adapter using a wire nut.
- 7:** Connect the low voltage -24VDC remote power supply wire to the black wire of the Power Feed Adapter using a wire nut.

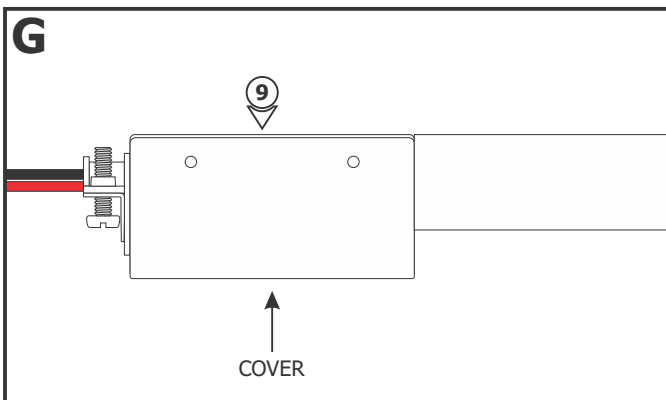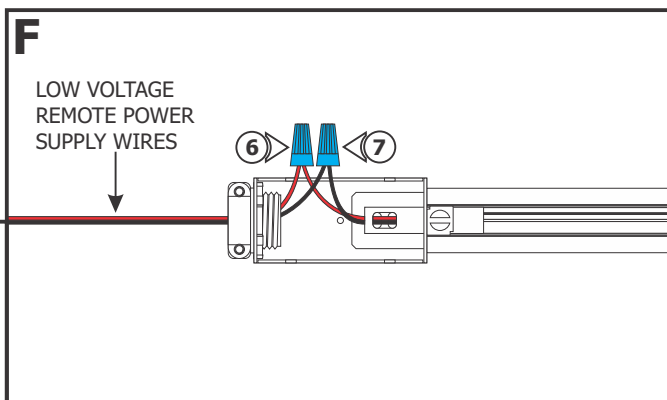

8: Place all wire nut connections inside the housing.

9: Replace the cover over the housing.

NOTE: Refer to the instructions provided with the TS24 Track Surface to complete the installation.

General Wiring Diagram

