

American Brass & Crystal


Casting a Finer Light



CH9323

American Brass and Crystal provides the finest quality components manufactured, designed and finished by master artisans. We take great pride in our production abilities and we empower our valued customers with the ability to custom create the light that is perfect for them.

Enclosed are detailed instructions on how to properly assemble and install your chandelier. If you have any questions please call our toll free customer service hotline at: **1-(877)-465-5617**

 American Brass and Crystal
835 Lehigh Avenue, Union, NJ 07083

www.abclighting.net




American Brass & Crystal

Casting a Finer Light




DIAGRAM 1

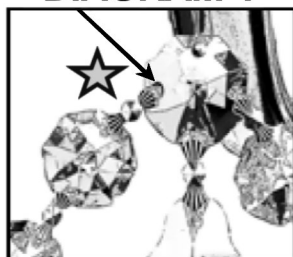

Refer to Diagram 1 when connecting the loose chain to the 4-hole octagon on the same lettered station on the adjacent arm to the right for letters E, H, K, CR1, and CR2.

You will see a (☆) at all positions where such a connection must be made.

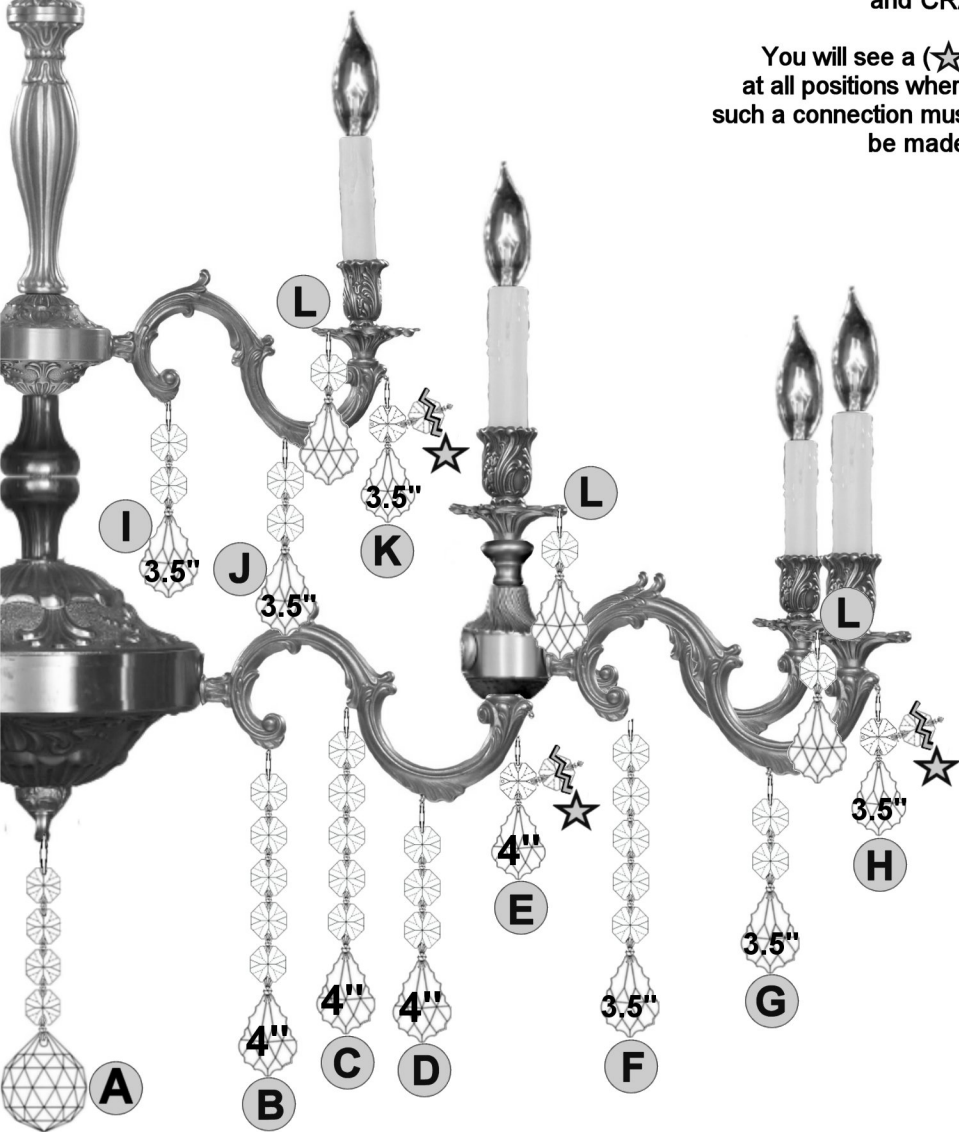

CRYSTAL TRIMMING DIRECTIONS

Begin trimming your chandelier after all of the electrical connections have been made, the lights have been tested and the chandelier is in good working order.

Begin dressing the chandelier and hanging the crystals in an Alphabetical Order.

Do not unwrap the next letter package of crystal until the proceeding section has been completed.

BOTTOM CENTER FINIAL

Step 1: Letter A : Quantity: 1

Attach the crystal strand with the 14 octagons and 70mm ball on the bottom center Finial.

SINGLE ARMS

Step 2: Letter B : Quantity: 8

Attach the crystal strand with the 12 octagons and crystal drop to the back hole of the arms closest to the center.

Step 3: Letter C : Quantity: 8

Attach the crystal strand with the 11 octagons and crystal drop to the middle-back hole of the arms.

Step 4: Letter D : Quantity: 8

Attach the crystal strand with the 3 octagons and crystal drop to the middle-front hole of the arms.

Step 5: Letter E : Quantity: 8

Attach the crystal strands with the drop shaped crystal to the 8 stations on the front hole of the single arms using the long thin pin. **Let the loose chain of crystal remain unattached until all 8 stations are hung. Then connect the loose strand of one station to the 4 hole octagon on the crystal section adjacent to the arm on the right. (See: DIAGRAM 1)**

SPLIT ARMS

Step 6: Letter F : Quantity: 16

Attach the crystal strand with the 5 octagons and crystal drop to the back hole of the split arms.

Step 7: Letter G : Quantity: 16

Attach the crystal strand with the 2 octagons and crystal drop to the middle hole of the split arms.

Step 8: Letter H : Quantity: 16

Attach the crystal strands with the drop shaped crystal to the 16 stations on the front hole of the split arms using the long thin pin. **Repeat directions from Step 2. (See: DIAGRAM 1)**

TOP TIER OF ARMS

Step 9: Letter I : Quantity: 8

Attach the crystal strand with the 12 octagons and crystal drop to the back hole of the top tier of arms.

Step 10: Letter J : Quantity: 8

Attach the crystal strand with the 6 octagons and crystal drop to the middle hole of the top tier of arms.

Step 11: Letter K : Quantity: 8

Attach the crystal strands with the drop shaped crystal to the 8 stations on the front hole of the top tier of arms using the long thin pin. **Repeat directions from Step 2. (See: DIAGRAM 1)**

BOBECHES

Step 12: Letter L : Quantity: 128

Attach the crystal strand with the 1 octagon and crystal drop to the Bobeches surrounding each of the lights on the single arm, split arms and top tier of arms.

CROWN

Step 13: Letter CR1 : Quantity: 6

Attach the crystal strands with the drop shaped crystal to the bottom hole of the 6 crown scrolls using the long thin pin. **Repeat directions from Step 2. (See: DIAGRAM 1)**

Step 14: Letter CR2 : Quantity: 6

Attach the crystal strands with the drop shaped crystal to the top hole of the 6 crown scrolls using the long thin pin. **Repeat directions from Step 2. (See: DIAGRAM 1)**