

American Brass & Crystal

Casting a Finer Light




CH9382

WITH CRYSTAL ON BOBECHES

American Brass and Crystal provides the finest quality components manufactured, designed and finished by master artisans. We take great pride in our production abilities and we empower our valued customers with the ability to custom create the light that is perfect for them.

Enclosed are detailed instructions on how to properly assemble and install your chandelier. If you have any questions please call our toll free customer service hotline at: **1-(877)-465-5617**

 American Brass and Crystal
835 Lehigh Avenue, Union, NJ 07083

www.abclighting.net



American Brass & Crystal

Casting a Finer Light


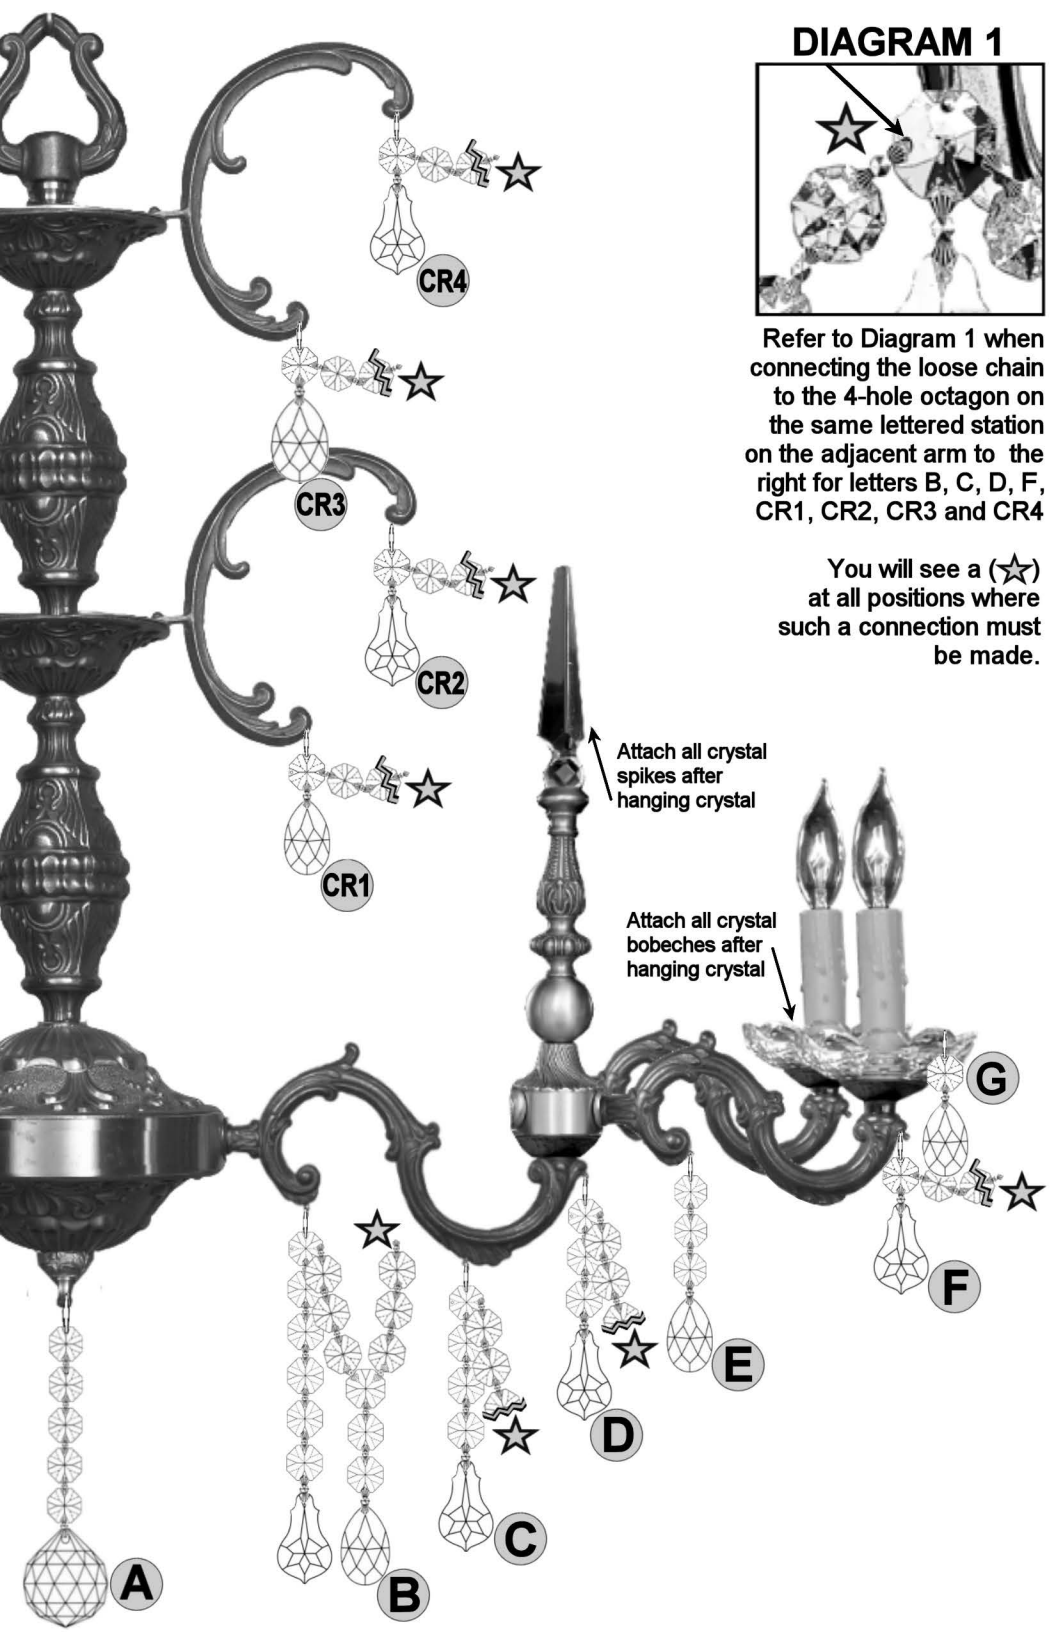


DIAGRAM 1

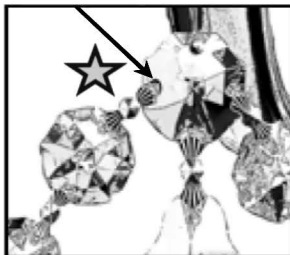

Refer to Diagram 1 when connecting the loose chain to the 4-hole octagon on the same lettered station on the adjacent arm to the right for letters B, C, D, F, CR1, CR2, CR3 and CR4

You will see a (★) at all positions where such a connection must be made.

Attach all crystal spikes after hanging crystal

Attach all crystal bobeches after hanging crystal

CRYSTAL TRIMMING DIRECTIONS

Begin trimming your chandelier after all of the electrical connections have been made, the lights have been tested and the chandelier is in good working order.

Begin dressing the chandelier and hanging the crystals in an Alphabetical Order.

Do not unwrap the next letter package of crystal until the proceeding section has been completed.

BOTTOM CENTER FINIAL

Step 1: Letter **A** : Quantity: **1**

Attach the crystal strand with the ball on the bottom center Finial.

ARMS

Step 2: Letter **B** : Quantity: **6**

Attach the crystal strands with the Bell shaped crystal to the 6 stations on the back hole of the arms using the long thin pin. Let the loose chain of crystal remain unattached until all 6 stations are hung. Then connect the loose strand of one station to the 4 hole octagon on the crystal section adjacent to the arm on the right. (See: DIAGRAM 1)

Step 3: Letter **C** : Quantity: **6**

Attach the crystal strands with the Bell shaped Crystal to the 6 stations on the middle hole of the arms using the long thin pin. Repeat directions from Step 2.

Step 4: Letter **D** : Quantity: **6**

Attach the 6 crystal strands with the pendalogue to the 6 stations on the front hole of the arms using the long thin pin. Repeat directions from Step 2.

SPLIT ARMS

Step 5: Letter **E** : Quantity: **12**

Attach the crystal strands with the Oval to the 12 stations on the back hole of each of the split arms using the long thin pin.

Step 6: Letter **F** : Quantity: **12**

Attach the 4-hole octagon with the Bell Shaped crystal to the 12 stations on the front hole of the arms using the long thin pin. Repeat directions from Step 2.

LOWER CROWN TIER

Step 7: Letter **CR1** : Quantity: **6**

Attach the 4-hole octagon with the Oval to the 6 bottom stations on the lower crown tier using the long thin pin. Repeat directions from Step 2.

Step 8: Letter **CR2** : Quantity: **6**

Attach the crystal strands with the Bell shaped crystal to the 6 top stations on the lower crown tier using the long thin pin. Repeat directions from Step 2.

UPPER CROWN TIER

Step 9: Letter **CR3** : Quantity: **6**

Attach the crystal strand with the Oval to the 6 bottom stations on the upper crown tier using the long thin pin. Repeat directions from Step 2.

Step 10: Letter **CR4** : Quantity: **6**

Attach the crystal strands with the Bell shaped crystal to the 6 top stations on the upper crown tier using the long thin pin. Repeat directions from Step 2.

OVERALL

Step 11: Quantity: **6**

Attach the crystal spikes to the stations on each arm.

Step 12: Quantity: **12**

Place the crystal bobeches around every candle light.

BOBECHES

Step 13: Letter **G** : Quantity: **60**

Connect **5** of the "G" crystals to each of the crystal bobeches on all 12 arms.

CRYSTAL PACKAGE _____ PIN COLOR _____ INITIALS _____